

CAR INSPECTION COMPREHENSIVE



POWERED BY

BeS@Ji.com

NEED HELP?

infouae@copart.com



Date
Monday, January 4, 2021

11:40 AM

Vehicle Details

Make CADILLAC	Model Escalade LWB	Year 2010
Engine Size 8-Cylinder	Mileage (KM) 224403	Fuel Type Petrol
Regional Specs American	Transmission Automatic	Interior Leather
VIN Number	Number of Keys	

Vehicle Summary

Mechanical: Shock absorbers have a leak front left and back right. Brake pads and rotors are rusted and need to be replaced. Stabilizer bushing front and back right are worn out, need to be replaced. ABS brake sensor wiring is disconnected in the engine bay. There is an oil leak between the engine and transmission. There are a set of wires that are disconnected in the undercarriage. The oil level was fine, but needs to be replaced due to being overused. Exhaust is upgraded.

1

Exterior: Please refer to the paint condition report. In addition, the rear hook cover is missing, as wellas the rear logo is worn out and the door locks are aftermarket so the doors don't close easily.

Interior: The odometer has been rolled back. You can see proof in the interior photos. The driver side door has really bad wiring done. None of the buttons work, as well as the side step sensors are not working. The locks are aftermarket.

Engine

Engine Upper Cover	Engine Shield Cover	Engine Mounts	
Pass	Iron cover is missing	Pass	
Engine Oil Level	Engine Oil Filler Cap	Engine Oil Leaks	
Pass	Pass	Engine to transmission oil leak	
Coolant Level	Coolant Cap	Radiator	
Pass	Pass	Pass	
Visible Rust	Exhaust Leaks	Engine Idle	
Rust on chassis	Pass	Pass	
Turbo / Supercharger	Bonnet Hinge & Holder	Fender Liners	
N/A	Pass	Pass	
Drive Belt / Pulleys	Hoses & Pipes		
Rusted pulleys	ABS Wiring damaged & disconnected		
Battery	Condition 🖈 🖈 🖈 🖈		


Transmission

Fluid Level & Oil Leaks	Gear Selector
Pass	Pass
Noise	Gear Shifting
Pass	Pass

Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Fault Photos

Drive Belt / Pulleys - Photo

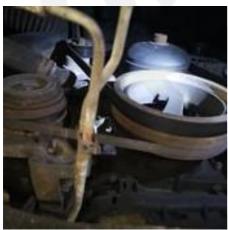


16111413138564597924830728538874

Shield Cover - Photo



16111412274803016933305464319122

Oil Leak - Photo

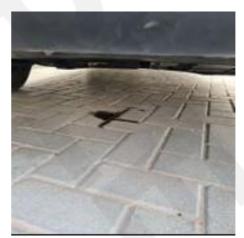

16112052983985161087498673393612



16112053182841617466100569774240

Hose Damage - Photo



IMG_20210120_152053.jpg

Visible Rust - Photo



16111414679338078530770279492030



16112055127127056806877152108013

Electrical System

Key Remote	Entertainment System	Center Console Buttons
N/A	Pass	Pass
Door Lock / Unlock	Cameras	Cruise Control
Driver side features not working	Pass	Pass
A/C Control & Cooling	Starting & Ignition System	Gauges
Pass	Pass	Pass
Fog Lights	Headlights	Brake Lights
Pass	Pass	Pass
A/C Grilles	High Beams	Reverse Lights
Driver left side A/C grille adjust doesn't work. Front passenger side A/C grille adjustment broken, A/C close wheel missing.	Pass	Pass
Number Plate Lights	Indicators & Hazards	Soft Closing Doors
Pass	Pass	N/A
Wipers	Interior Lights	Sunroof / Moonroof
Pass	Roof light for last row not working	Pass
Windows Operation	Horn	Parking Sensors
Pass	Pass	Pass
Seats Adjustment (Power/Mar	nual) Rear View /	Side Mirror Electricals
Pass	Right side door don't	mirror is broken. All buttons ondriver work.

Brake System, Rims & Tyres

Brake Pads Front

Needs to be replaced

Brake Discs Front

Needs to be replaced

Traction Control

Button not working

ABS Sensors

Wiring is cut from under and disconnected

Brake Pads Rear

Needs to be replaced

Brake Discs Rear

Needs to be replaced

Handbrake

Brake fault light on. Leak also prominent.

Spare Tire

Available

Rims

	Brand	Condition
Front Left	OEM	Good
Front Right	OEM	Paint peeling, rust visible
Rear Left	OEM	Minor curb scratches
Rear Right	OEM	Paint peeling, rim lip bent
Spare		

Tyres


	Manufacturer	Date	Size	Condition
Front Left	Bridgestone Dueler H/L	2014	285/45/22	1/5
Front Right	Michelin Defender LTX	2017	285/45/22	3/5
Rear Left	Ironman iMove Gen2	2019	285/45/22	4/5
Rear Right	Bridgestone Dueler H/L	2018	285/45/22	Replace Soon
Spare	Not Available			



Front Left Tyre



Front Right Tyre

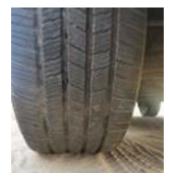

Rear Left Tyre



Rear Right Tyre



Interior

Roof Lining

Pass

Rear View Mirror

Pass

Armrest & Side Pockets

Leather crack on center box

Steering Wheel Upholstery

Pass

Seats Upholstery

Regular leather cracks due to wear and tear

Gear Lever

Pass

Floor Mats

General dirt + wear and tear

Trunk Lining

Pass

Dashboard

Far right cover is broken

Front Windscreen

Cracked

Rear Windscreen

Wiper scratch marks

Doors

Front left door sensor for side steps doesn't work. Driver window deep scratches. Rear left door doesn't close smoothly. Front passenger exterior door sill scratched and missing chrome extension piece.

Service History & Manuals

Service History


User Manual

Not Available


Available

Exterior & Interior Report

Paint Condition

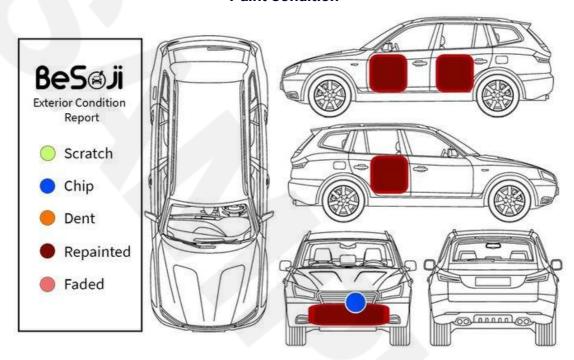

BeSiji Chassis Damage Report

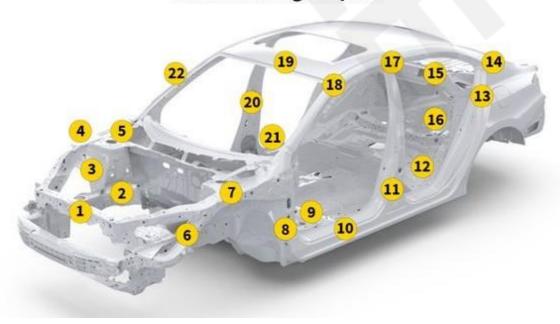

Damage on chassis:

9

Exterior Photos

File Upload



IMG_20210120_164802.jpg



IMG_20210120_164809.jpg



IMG_20210120_164818.jpg



IMG_20210120_164827.jpg



IMG_20210120_164836.jpg



IMG_20210120_165020.jpg



IMG_20210120_165054.jpg



IMG_20210120_165212.jpg



IMG_20210120_165220.jpg



IMG_20210120_165321.jpg



IMG_20210120_165332.jpg



IMG_20210120_165338.jpg



IMG_20210120_165345.jpg



IMG_20210120_165355.jpg



IMG_20210120_165515.jpg



IMG_20210120_165544.jpg



Engine Bay & Undercarriage

File Upload

IMG_20210120_151942.jpg



IMG_20210120_152002.jpg



IMG_20210120_152013.jpg





IMG_20210120_152118.jpg



IMG_20210120_152546.jpg



IMG_20210120_152555.jpg



IMG_20210120_152558.jpg



IMG_20210120_153659.jpg

Interior Photos

File Upload







IMG_20210120_165655.jpg

IMG_20210120_165850.jpg

IMG_20210120_170130.jpg

Vehicle Diagnostic Report

File Upload



Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report

in no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.